

REF: Production Change #3240  
FOUND IN KIT: Immediately  
TRANS: 01J Multitronic  
DATE: October 29, 2013  
AFFECTED KITS: K40900R, K40900RX and all related Master and Banner kits.

This unit experienced many forward clutch feed failures as well as forward clutches burning out as a result of the OE plastic ring and the lack of support it offers the Forward clutch feed pipe. In our series of 01J kits we have recently added repair kit number K40900R-2 which contains the Forward clutch feed pipe along with the Oring and an upgraded Teflon ring\* which will provide a firmer fit into the suction pump thus giving the feed pipe more stability.

\*40574 is new special Teflon ring