



PRECISION[™]
INTERNATIONAL


PRESENTS

TECH TIPS TO HELP YOU AT THE SHOP BENCH

the problem solvers

4L70 Pump Stator Bushings Wear Concerns

The pump stator bushings on the 4L70 have been known to wear out with great frequency. Excessive wear in the stator bushings will allow the input drum to “wobble” causing PO716 and PO717 codes to manifest themselves. Make sure to closely inspect this area during rebuild.

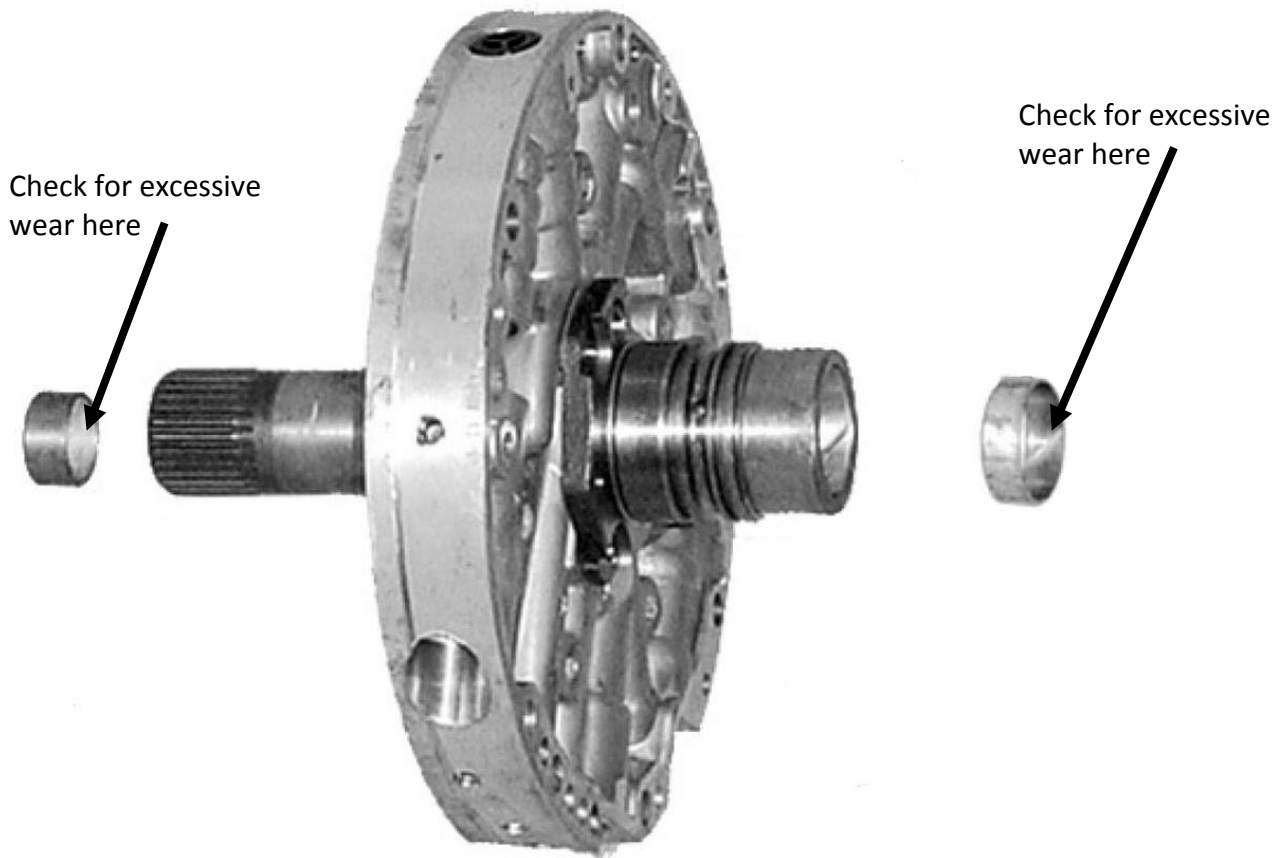

Precision International is a worldwide supplier of quality products for import and domestic automatic transmissions. As well as supplying an extensive aftermarket customer base, we also provide product to Original Equipment Manufacturers. Precision International is dedicated to providing the most up-to-date information available in the industry today.