



**PRECISION**<sup>™</sup>  
INTERNATIONAL


PRESENTS

TECH TIPS TO HELP YOU AT THE SHOP BENCH

*the problem solvers*


## 09G/TF60SN Valve Body Gasket Update

Precision International is pleased to announce the update to the 09G/TF60SN valve body gasket. The original design had a tendency to blow out causing the paper material to clog the valve body. New design, PI #79940A, has paper material removed from gasket to combat the issue of valve body clogging. As of date code 12146 you will notice new gasket in our K79900HX overhaul kit family. See illustrations below that highlight our updated design.

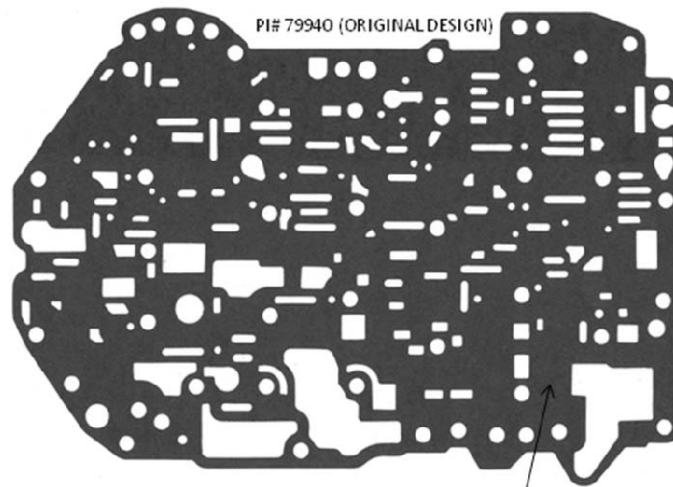

PI# 79940 (ORIGINAL DESIGN)

Area of gasket that blows out and causes paper material to clog valvebody.

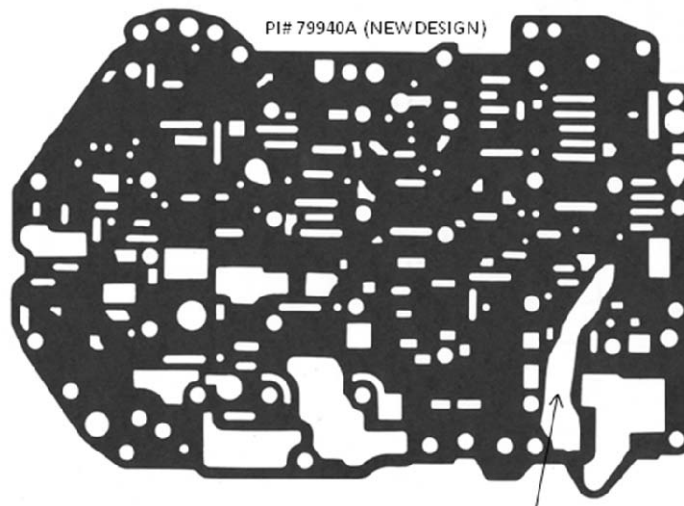

PI# 79940A (NEW DESIGN)

Paper material that is removed from gasket to combat the issue of valvebody clogging.



**Precision International** is a worldwide supplier of quality products for import and domestic automatic transmissions. As well as supplying an extensive aftermarket customer base, we also provide product to Original Equipment Manufacturers. Precision International is dedicated to providing the most up-to-date information available in the industry today.