



PRECISION[™]
INTERNATIONAL

PRESENTS


TECH TIPS TO HELP YOU AT THE SHOP BENCH

the problem solvers

4L65/4L70 Separator Plate Concern

The valve body separator plate in late model 4L65/4L70 now has non-removable bonded gaskets. Hydramatic has also added flat solenoid screens. In the past there were only two screens. There is now a third screen by the shift solenoids. These screens are not serviceable as they are bonded with the gasket. GM had an issue with debris (usually case aluminum flashing) getting to the shift solenoids, causing P0756 shift solenoid "B" performance.

This concern was happening on vehicles with less than 5,000 miles on them, and still under warranty. Precision International has released a separator plate to fit all models of 4L65/4L70. Look for this separator plate in our newly released KP33900N and KP33900NX overhaul kits.

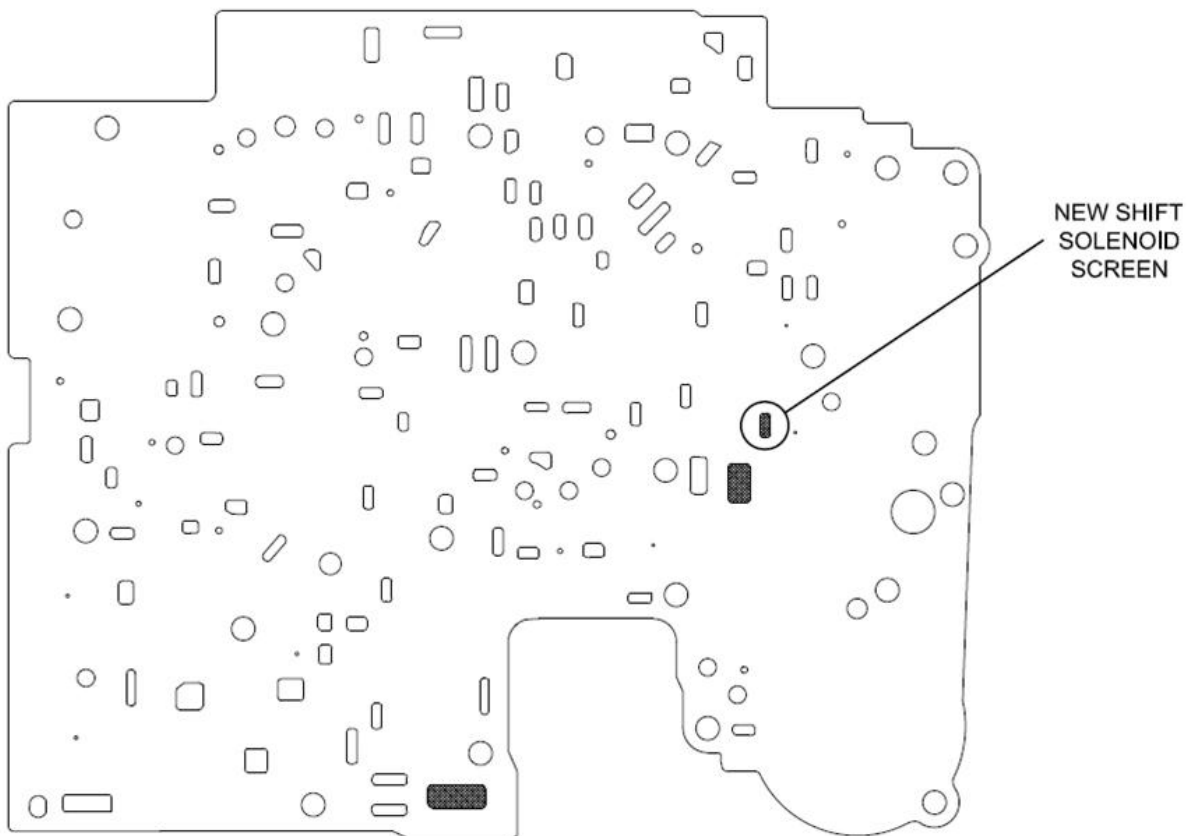

Precision International is a worldwide supplier of quality products for import and domestic automatic transmissions. As well as supplying an extensive aftermarket customer base, we also provide product to Original Equipment Manufacturers. Precision International is dedicated to providing the most up-to-date information available in the industry today.