



PRECISION[™]
INTERNATIONAL

PRESENTS


TECH TIPS TO HELP YOU AT THE SHOP BENCH

the problem solvers

722.6 - Bind During 3-4 Shift Fix

Precision International is pleased to announce a fix to the 722.6 bind during the 3-4 shift. Dodge, Chrysler, Jeep and Mercedes Benz vehicles with the 722.6 transmission have had complaints of a bind during the 3-4 shift. This symptom may occur before and after overhaul.

The cause of this bind during the 3-4 shift may be a broken 3-4 Shift Pressure Valve Spring. Precision International now includes a replacement 3-4 Shift Pressure Valve Spring in its K56900G and K56900GX overhaul kits. It is recommended to be replaced during each rebuild. Look for sub-kit SUB-K56799A found in overhaul kits with a date code of 11262 and on.

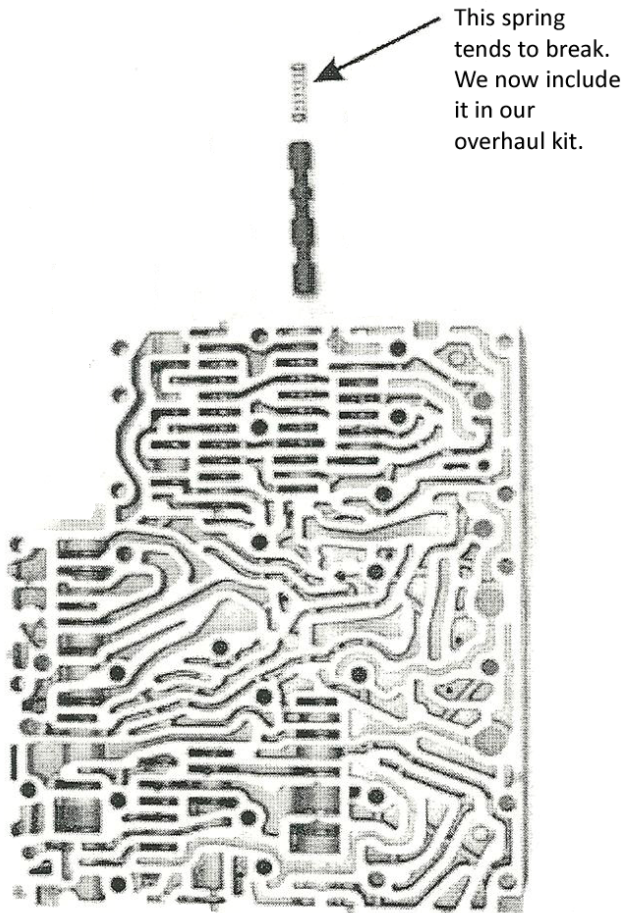

Precision International is a worldwide supplier of quality products for import and domestic automatic transmissions. As well as supplying an extensive aftermarket customer base, we also provide product to Original Equipment Manufacturers. Precision International is dedicated to providing the most up-to-date information available in the industry today.