




PRECISION **INTERNATIONAL**



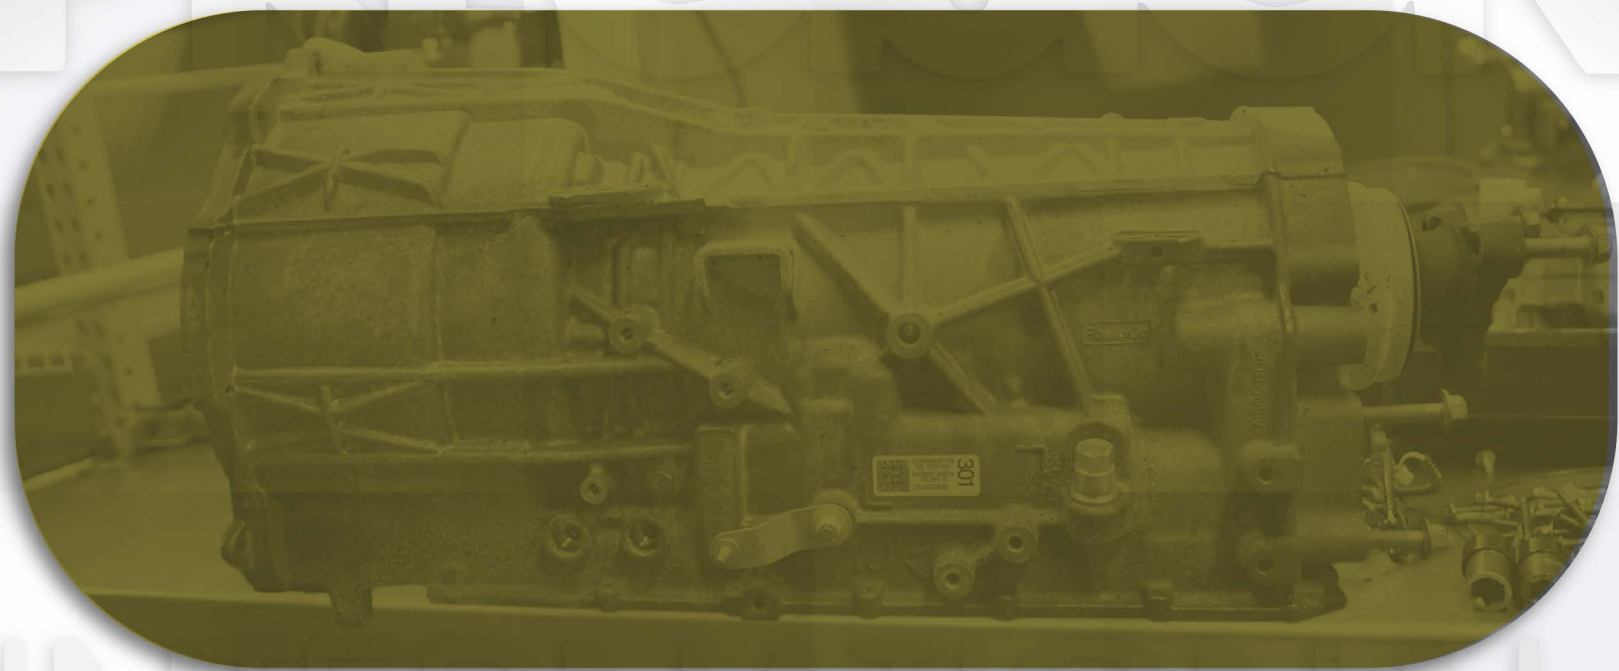


TRANSMISSIONKITS.COM

***An Automotive Leader
in Automatic
Transmission Repair***

8F35 KITS INCLUDING BONDED VALVE BODY PLATES

Due to the presence of embedded screens in the Main Lower Valve Body Separator plates in 8F35 units, we have now discontinued the loose gaskets (and the kits containing them) and replaced them with the bonded plates, included in our new kits as per the revised Problem Solver.

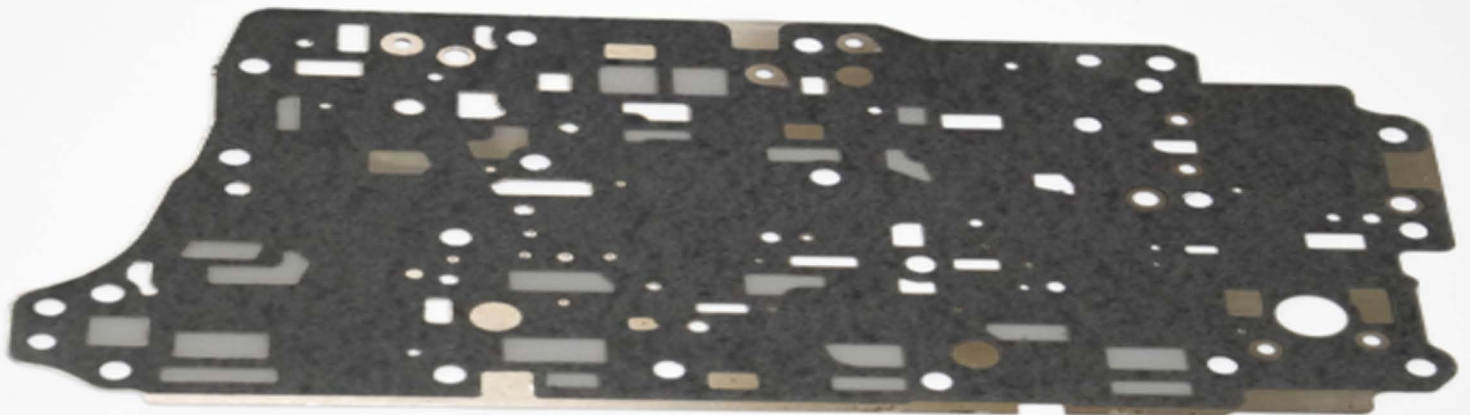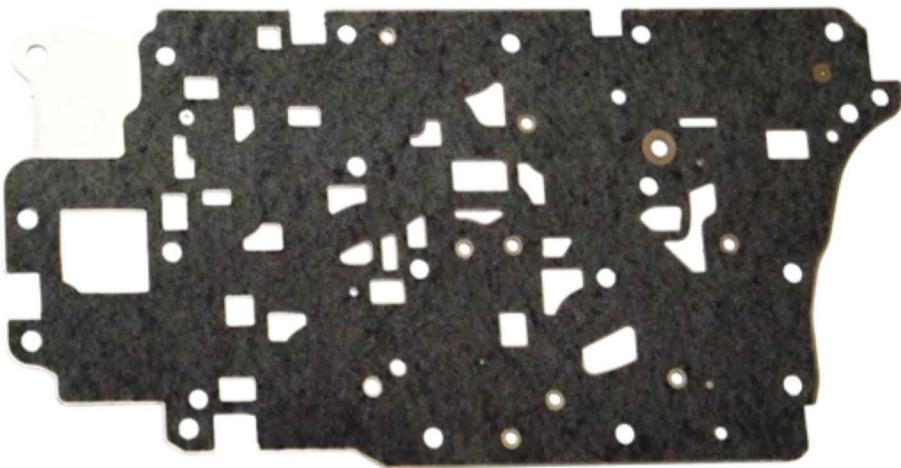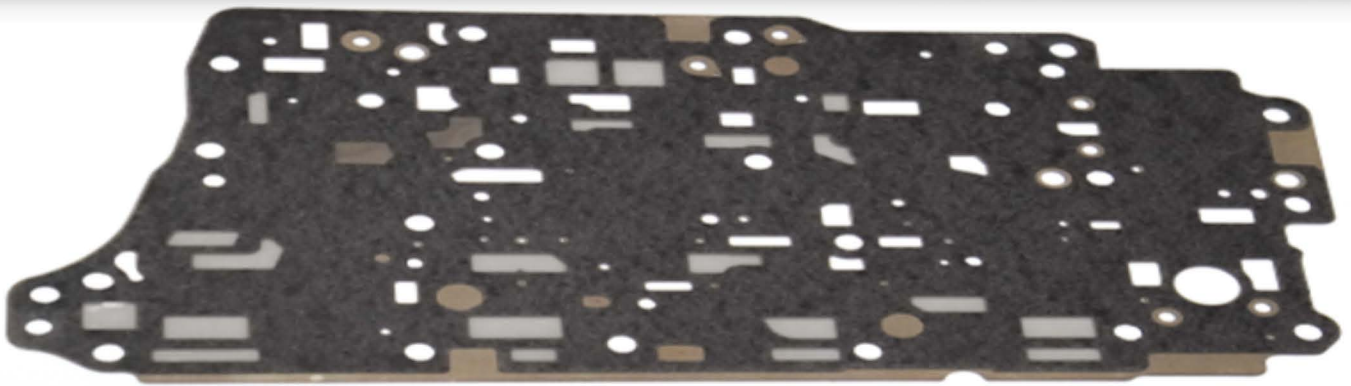

6L80/90 1-2-3-4/3.5 REVERSE DRING SUPER-SESSION

We have replaced the following Drings as per a GM running change:

- 33509 (1-2-3-4 lower Dring) was 5.060" ID
- 33131 (1-2-3-4/3-5 Reverse Dring) was 5.120" ID

Since they were so close in diameter and both included in the same sub package, we added a white dot on the 33131 to help the builder distinguish the location for each. Then we explained this on the bag. Recently, we set up new P/N 33131A, which is 5.000" ID. It has no white dot and has replaced both 33509 and 33131 as per GM super-session. The note on the sub kit bag has been removed as well. In conclusion, there will be 2 pcs. 33131A in the kit, no dots and notations on the bags.



NEW PI PART #: 33131A

10R80 INPUT SHAFT, DIRECT/OD SEALING RING DESIGN CHANGES:

Subtle spec changes to the 10R80 Input Shaft and Overdrive/Direct Sun Gear rings significantly improve shift quality. While General Motors maintains these original rings in their 10L80/10L90 applications, Ford made the following changes to these solid rings:

1-Input Shaft-small (5 pcs.)

Was PI# 33613	Ford# HL3Z-7G091-D	1.422" OD X .083" TH X .076" RW
Now PI# 37613	Ford# HL3Z-7G091-F	1.410" OD X .082" TH X .075" RW



PI Part #: 37613

While the most significant change is the decrease in outer diameters, the slight change in the radial wall has an effect as well.

10R80 INPUT SHAFT, DIRECT/OD SEALING RING DESIGN CHANGES:

2-Input Shaft -Large (5 pcs.)


Was PI# 33614 Ford#HL3Z-7G091E 1.645" OD X .083"TH X .085" RW

Now PI# 37614 Ford# HL3Z-7G091-G 1.630" OD X .082"TH X .083" RW

PI Part #: 37614



PI Part #: 37615

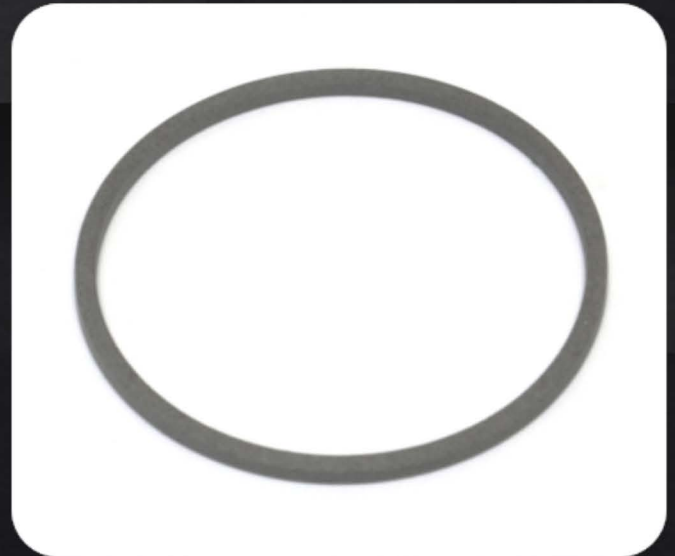

3-Direct/OD Sun Gear (4 pcs)

Was PI# 33615 Ford# HL3Z-7G091-B 2.125" OD X .083"TH X .085" RW

Now PI# 37615 Ford# HL3Z-7G091-C 2.106" OD X .083"TH X .083" RW

While the most significant change is the decrease in outer diameters, the slight change in the radial wall has an effect as well.

8L45/90 START/STOP REPAIR PACKAGE NOW AVAILABLE

We now have available a package to rebuild the 8L45 & 8L90 Start/Stop Pump:

Sub-K3398 contains:

- 33078 Dring, Start/Stop Accumulator Piston
- 33304 Torlon Ring, Start/Stop Accumulator Piston
- 33394 Torlon Ring, Start/Stop Accumulator Shaft
- 31015 Oring, Start/Stop Solenoid LG
- 37496 Oring, Start/Stop Solenoid SM

PI#: 33304



PI#: 37496



PI#: 33394



PI#: 33078



What's New at Precision?

Notable product releases at Precision International! Problem solvers for these kits and all other new releases can be downloaded on our website.

K82900EE - 8HP51

8HP51 KITS AVAILABLE NOW

Coverage:

2019-24 BMW 330i/x 2.0L
2019-22 BMW X7 3.0L
2019-24 BMW Z4 2.0L, 3.0L
2020-23 BMW 530i/x 2.0L
2020-23 BMW 540i/x 3.0L
2020-22 BMW 740i/x 3.0L
2020-24 BMW 840i/x 3.0L
2020-24 BMW M340i/x 3.0L
2020-24 BMW X3i/x 2.0L
2020-24 BMW X4 2.0L, 3.0L
2020-23 BMW X5i/x 3.0L
2020-23 BMW X6i/x 3.0L
2021-24 BMW M440i/x 3.0L
2022-24 BMW 230i/x 2.0L
2022-24 BMW 430i/x 2.0L
2022-24 BMW M240i/x 3.0L
2024-25 JAGUAR F-PACE 2.0L
2024 JAGUAR XF 2.0L
2023-25 LAND ROVER DEFENDER 2.0L
2023-25 LAND ROVER DISCOVERY 2.0L

Part Number: K82900

- ▶ Overhaul Kits
- ▶ Banner Kits
- ▶ Master Kits
- ▶ Piston Kits

KP37900Q - 10R80 Hybrid



NOW AVAILABLE

HYBRID

10R80 HYBRID

Precision is proud to announce the release of our newest kit, KP37900Q! This kit covers the Ford 10R80 Hybrid unit which includes the following models and year coverage:

- Ford Explorer 3.3L 2020-2023
- Ford Police Interceptor 3.3L 2020-2025
- Ford F-150 3.5L 2021-2025
- Lincoln Aviator 3.0L 2020-2024

MORE INFORMATION

- Email: Sales@transmissionkits.com
- Phone: 800.872.6649
- Web: www.transmissionkits.com

KP37900R - 10R60

10R60

Introducing our new 10R60 Kit Product Line, built to deliver everything you need for a complete, efficient rebuild in one package. Ask for PI part number KP37900R(X) and all related banner and master kits.

COVERAGE INCLUDES THE FOLLOWING:

- 2020-25 Ford Explorer (2.3L, 3.0L, 3.3L)
- 2021-24 Ford Bronco (2.3L, 2.7)
- 2024 Ford Ranger (2.3L, 2.7L, 3.0L)
- 2020-25 Ford Police Interceptor (3.0L)
- 2020-25 Lincoln Aviator (3.0L)

K82900JJ - 8HP76

NOW AVAILABLE ZF 8HP76

COVERAGE

- 2019-25 BMW M850i/Gran Coupe 4.4L
- 2019-22 BMW X8 4.4L
- 2020-22 BMW 750i/x 4.4L
- 2020-22 BMW Alpina B7
- 2020-23 BMW M550i/x 4.4L
- 2020-25 BMW M8/Gran Coupe 4.4L
- 2020-24 BMW X3M 3.0L
- 2020-25 BMW X4M 3.0L
- 2020-23 BMW X5 & X5M 4.4L
- 2020-23 BMW X6 & X6M 4.4L
- 2021-22 BMW Alpina XB7 4.4L
- 2021-25 BMW M3 3.0L
- 2021-25 BMW M4 3.0L
- 2022-25 BMW Alpina B8/Gran Coupe 4.4L
- 2022-23 BMW M5 4.4L
- 2023-25 M2 3.0L
- 2021-25 Jaguar F-Pace 3.0L



**PRECISION
INTERNATIONAL**

APPLICATION

2019-25 BMW M850i/Gran Coupe 4.4L

2019-22 BMW X8 4.4L

2020-22 BMW 750i/x 4.4L

2020-22 BMW Alpina B7

2020-23 BMW M550i/x 4.4L

2020-25 BMW M8/Gran Coupe 4.4L

2020-24 BMW X3M 3.0L

2020-25 BMW X4M 3.0L

2020-23 BMW X5 & X5M 4.4L

2020-23 BMW X6 & X6M 4.4L

2021-22 BMW Alpina XB7 4.4L

2021-25 BMW M3 3.0L

2021-25 BMW M4 3.0L

2022-25 BMW Alpina B8/Gran Coupe 4.4L

2022-23 BMW M5 4.4L

2023-25 M2 3.0L

2021-25 Jaguar F-Pace 3.0L

MODELS APPLICATIONS

CHARACTERISTICS

NOTATIONS FROM MODEL TO THE SAME CONFIGURATION IS THE SAME